



TEST REPORT

CEPRI-EETC08-2019-0543 (E)

Client: Shenzhen Woer Electric Technology Co., Ltd.

Object: Plug in type dry GIS termination for 64/110 kV

XLPE cable

Type: WYJZGGC 64/110 1×1600

Test Category: Type tests



CENTER FOR ELECTRIC EQUIPMENT

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 1

Catalogue

1. Catalogue	
2. Signature Page	
3. Test Results	
4. Content	
5. Appendix A Object Parameters	
6. Appendix B The Main Test Devices	
7. Appendix C Test Circuit Diagrams	8
8. Appendix D Waveform	9
9. Appendix E Identification of test cable	11

Test Report	Power Industry Quality Inspec Center for Electric Equi	ction and Test ipment	CEPRI-EETC08-2019-0543(E) Total 11 Page 2
Client	0 × 0 × 0 × 0	Manufacturer	Shenzhen Woer Electric Technology Co., Ltd.
Object	Plug in type dry GTS termination for 64/110 kV XEPE cable	Туре	WYJZGGC 64/110 1×1600
Sampling procedure	检测报告 Taken by client self 用章	Serial No.	EETC08-19/06/08-002
Test Category	Type tests	Date	2019.06.22~2019.08.26
Requirements	 GB/T 11017.3—2014 Power can their accessories for rated voltage of their accessories for rated voltages about accessories for rated voltages about -Test methods and requirements 	of 110 kV ($U_{\rm m}$ =12) Power cables W	ith extruded insulation and the
Conclusion	The plug in type dry GIS terminat which is WYJZGGC 64/110 1×1600 passed the type tests specified in GE		
Note	In the event of any difference in me English version.	eanings, the Chine	se report shall take priority over t
Compiled by	意物を打	倪玉林	湿料
Checked by:	徐明忠	Verified by	: 陶孟昆 阅 孟 茂
Approved b	y: 邬雄	Date of iss	ue: 2019.10.11.
U 168 70 68 7	0 84 40 84 40 84 40		

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 3

Test Results

No.	Item	Item Requirements Results		Evaluation	
1	Pressure leak test	(250±10) kPa for 1 h, no leakage shall occur	(250±10) kPa for 1 h, no leakage occurred	Passed	
2	Vacuum leak test	content in this report	The increased value of vacuum pressure did not exceed 10 kPa	Passed	
3	Partial discharge test at ambient temperature	No detectable discharge from the test assembly at 96 kV under a background noise	No detectable discharge was found from the test assembly at 96 kV under a background noise of 1.21 pC	Passed	
4	Heating cycle voltage test	As per clause 1.4 of content in this report	Subjected to heating cycle voltage test, and heating cycle had been carried out 20 times	Passed	
5	Partial discharge test at high temperature	No detectable discharge from the test assembly at 96 kV under a background noise	No detectable discharge was found from the test assembly at 96 kV under a background noise of 1.21 pC	Passed	
6	Partial discharge test at ambient temperature	No detectable discharge from the test assembly at 96 kV under a background noise	No detectable discharge was found from the test assembly at 96 kV under a background noise of 1.21 pC	Passed	
7	Lightning impulse voltage test	The test assembly shall withstand without failure 10 positive and 10 negative voltage impulses of 550 kV	No breakdown occurred on the test assembly at 10 positive and 10 negative voltage impulses of 550 kV	Passed	
8	Power frequency voltage test after lightning impulse voltage test	The test assembly shall be subjected to a power frequency voltage test at 160 kV for 15 min, and no breakdown of the insulation shall occurred	The test assembly have been subjected to a power frequency voltage test at 160 kV for 15 min, and no breakdown of the insulation was occurred	Passed	
9	Examination	As per clause 1.6 of content in this report	No signs of deterioration which could affect the system in service operation was found	Passed	

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 4

Content

1. Test methods

1.1 Pressure leak test

After the sample was installed, the sample shall be filled to a pressure of (250±10) kPa and maintained for 1 h at ambient temperature, no gas leakage shall occur at the sealed surface.

1.2 Vacuum leak test

After the sample was installed, the sample at environment temperature vacuum to the residual pressure is 10 kPa and maintained for 1 h. At the end of the test, the increased value of vacuum pressure shall not exceed 10 kPa.

1.3 Partial discharge tests

The tests were carried out at ambient temperature and high temperature in accordance with GB/T 3048.12 and IEC 60885-3, There shall be no detectable discharge exceeding the declared sensitivity from the test object at 96 kV. The background noise is no more than 1.21 pC during these tests.

The test voltage shall be raised gradually to and held at 112 kV for 10 s and then slowly reduced to 96 kV and the partial discharge tests were carried out at 96 kV. At high temperature the test shall be performed on the sample at a conductor temperature of $(95 \sim 100)$ °C. The conductor temperature shall be maintained within the stated temperature limits for at least 2 h.

1.4 Heating cycle voltage test

According to GB/T 11017.3—2014 and IEC 60840(Edition 4.0): 2011, the test assembly shall be heated by conductor current until the cable conductor reaches a temperature of $(95\sim100)$ °C. The heating shall be applied for at least 8 k. The conductor temperature shall be maintained with in the stated temperature limits for at least 2 h of each heating period. This shall be followed by at least 16 h of natural cooling to a conductor temperature less than or equal to 30 °C or within 10 K of ambient temperature, whichever is the higher. The cycle of heating and cooling shall be carried out 20 times. During the whole of the test period a voltage of 128 kV shall be applied to the sample.

1.5 Lightning impulse voltage test followed by a power frequency voltage test

The assembly shaff be heated by conductor current only, until the cable conductor reaches a steady temperature of $(95\sim100)$ °C. The conductor temperature shall be maintained within the stated temperature limits for at least 2 h.

The lightning impulse voltage shall be applied according to the GB/T/3048.13. The assembly shall withstand without failure or flashover 10 positive and 10 negative voltage impulses of 550 kV. After the lightning impulse voltage test, the test assembly shall be subjected to a power frequency voltage test at 160 kV for 15 min. No breakdown of the insulation.

1.6 Examination

Examination of the accessories by dissection of a sample and, whenever possible, of the accessories by dismantling with normal or corrected vision without magnification shall reveal no signs of deterioration (e.g. electrical degradation, leakage, corrosion or harmful shrinkage) which could affect the system in service operation.

2. Test data

The values of lightning impulse voltages on the test assembly after heating cycle voltage test (at high temperature, 550 kV, $\pm 3 \%$ tolerance)

Ambient temperature: 33.0 °C Relative humidity: 52 % Barometric pressure: 0.1012 MPa

	(7 QV	- 20	97	0 -0	7,40	389	1/2 - 2	u	nit: kV
Positive voltages	554	543	551	553	547	552	555	550	553	551
Negative voltages	551	548	562	561	550	549	549	548	548	547

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E)
Total 11 Page 5

Appendix A Object Parameters

A.1 Specification of sample

A.1.1 Sample state

The sample was manufactured in May, 2019, and was received on June 08, 2019 at Power Cable Quality Inspection Station of Power Industry Quality Inspection and Test Center for Electric Equipment, and it was in good condition without breakage.

A.1.2 Related information of sample

The material of connector is copper (72), the material used for stress relief cone is Ethylene Propylene Diene Monomer (EPDM), and the cable conductor is compacted with the connector by pressure.

A.1.3 Installation description

The sample to be tested has been installed by the manufacturer on a XLPE insulated single core cable with rated voltage 64/110 kV and having a cross-section of 1600 mm², the type and size of cable is ZB-YJLW02-Z 64/110 1×1600.

A.2 Photograph of sample




(There is no content below this page)

POWer

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 6

A.3 The dimensions of main construction of the sample tested

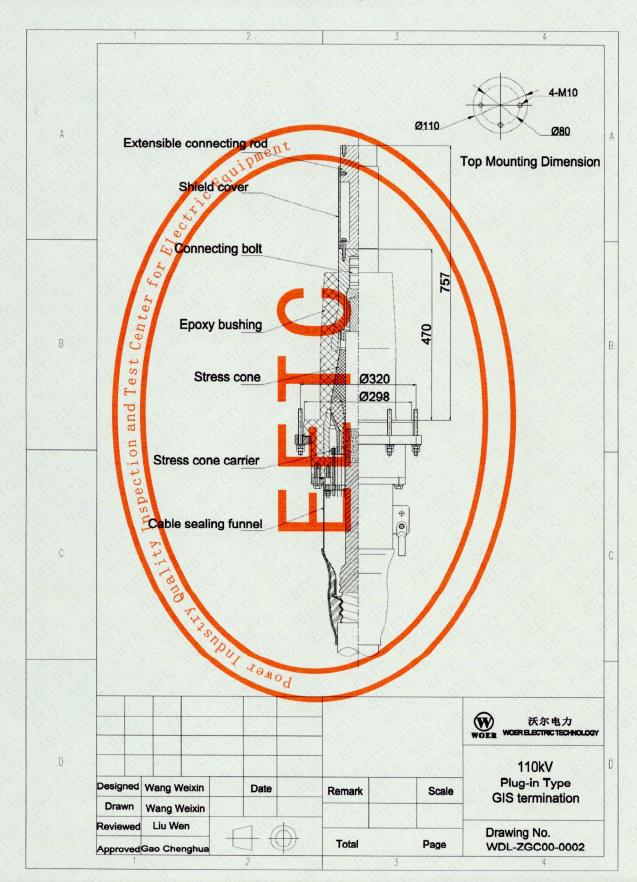

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 7


Appendix	B	The Main	Test	Devices
-----------------	---	----------	------	---------

Sequ- ence	Name of the equipment and instruments Type/Size	Serial No.	Full-scale range	Uncertainty / Accuracy	Verification / Calibration authority	Term of validity
1	RSZ-800-6-50 Corona-free series-resonant test system	204488	nt ^(0~800) kV	_		
2	KKF-800-5 Power frequency voltage divider	454485	(0∼800) kV	Class 1	National Meterage Center of High Voltage and Heavy Current	2020.07.21
3	Digital partial discharge detectot	2013-023	(0.1~999) pC	10 %	National Meterage Center of High Voltage and Heavy Current	2019.11.04
4	CJDY-3000/600 Impulse voltage generator	01	(0~3000) kV		_	
5	CJDY-3000 HV divider for impulse voltage divider measurement	001	(0∼3000) kV	Class 1	National Meterage Center of High Voltage and Heavy Current	2020.07.0
6	HiAS1214 Digital impulse Voltage analysis system	28npur 401 20050512	° (∅ ~3000) kV	Class 3	National Meterage Center of High Voltage and Heavy Current	2020.05.20
7	272 Wet and dry bulb hygrometer	304	(0∼50) °C	General	Hubei Meteorological Metrology Station	2019.10.11

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 8

Appendix C Test Circuit Diagrams

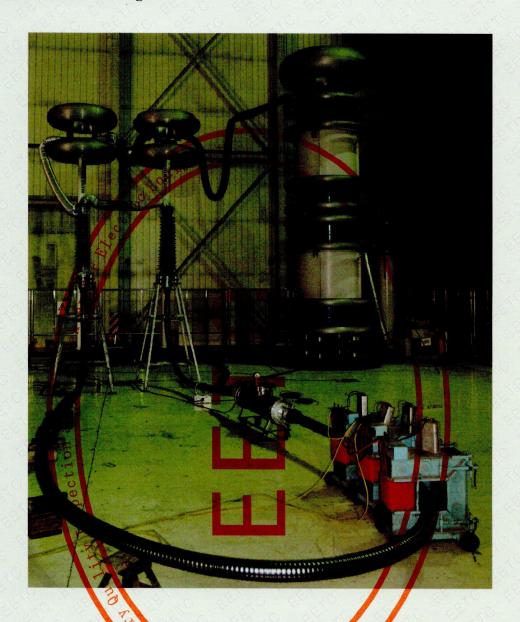


There is no content below this page)

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 9

Appendix D Waveform

D.1 Oscillograms of the lightning impulse voltages waveform

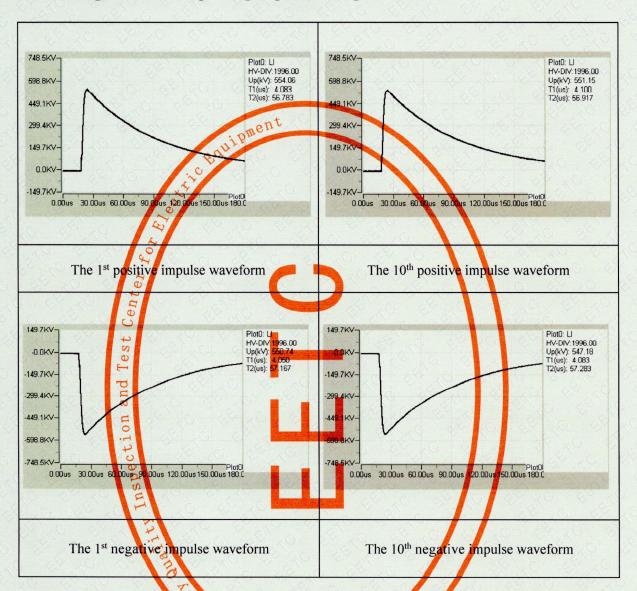


(There is no content below this page)


Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 10

- D.2 Oscillograms of partial discharges
- D.2.1 The background noise during partial discharge tests

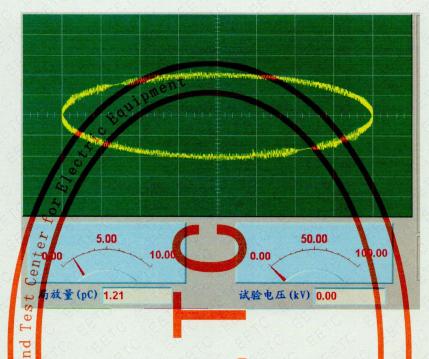

D.2.2 The oscillogram of partial discharges at 96 kV (After heating cycle voltage test at high temperature)

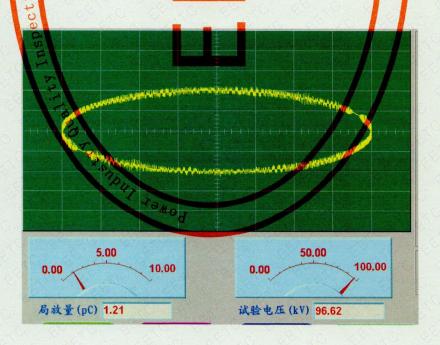

Power Industry Quality Inspection and Test Center for Electric Equipment

CEPRI-EETC08-2019-0543(E) Total 11 Page 11

Appendix E Identification of test cable

Rated	voltage $U_0/U(U_{\rm m})$ kV	64/110 (126) kV			
Construction	Core	Single core			
	Material	Copper TR			
	Construction	Milliken conductor			
Conductor	Cross section	1600 mm ²			
	Diameter	48.6 mm			
	Average thickness of conductor screen	1.9 mm			
6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6	Material	XLPE			
	Average thickness	1 <mark>6</mark> .0 mm			
t Ce	Diameter	86.3 mm			
Screen and Test	Average thickness of insulation screen	1.1 mm			
	Diameter of insulation screen	87. <mark>4</mark> mm			
Cushion and longitudinal water mpermeable barries	Material	Three layers of semi-conducting elastic water impermeable swell tape			
In	Material	Aluminum			
Corrugated metallic.	Average thickness	2.3 mm			
Sicau	Manufacturing technology of metallic sheath	Seam welded corrugated aluminum sheath			
	Material Material	PE			
Oversheath	Average thickness	6.6 mm			
0 45 0 4	Diameter	119.7 mm			
	Capacitance	270 pF/m			
Outer dia	ameter of complete cable	119.7 mm			
	Marking of cable	扬州曙光电缆股份有限公司 ZB-YJLW02-Z 64/110 kV 1×1600 2019 年 5 月			